LED Tail Lights - Model 279 J Series

PRODUCT INFORMATION

Description 12-24V DOT LED Jeep Tail Light Kit - 2

Light Kit

 Height
 210.31 mm / 8.28 in

 Width
 153.67 mm / 6.05 in

 Depth
 87.12 mm / 3.43 in

ShapeRectangularOuter Lens MaterialAcrylicOuter Lens ColorClear

Housing Material Polycarbonate

Housing ColorBlackBezel ColorBlack

Mounting Hardware (x4) #8-16 x 2 Pan Head, Self Tapping


Description Plastite Screw


Connector or WiringYAZAKI 7287-2779-30Mating ConnectorYAZAKI 7282-5553-30Product Weight6.40 lbs / 2.9 kgsShipping Weight5.80 lbs / 2.63 kgs





PRODUCT DIMENSIONS

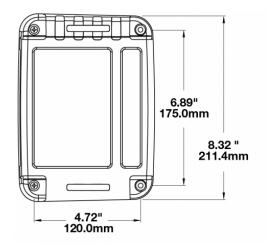

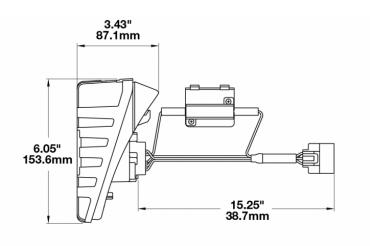

LED Tail Lights - Model 279 J Series

ELECTRICAL SPECIFICATIONS

Input Voltage12-24V DCOperating Voltage9-32V DC

Transient Spike Protection 150V Peak @ 1 HZ-100 Pulses

Black Wire Ground
Purple Wire Tail
Yellow Wire Stop
Green Wire Reverse

Current Draw 1.70A @ 12V DC (Stop/Turn)

0.21A @ 24V DC (Stop/Turn) 0.10A @ 12V DC (Tail) 0.09A @ 24V DC (Tail) 0.18A @ 12V DC (Reverse) 0.10A @ 24V DC (Reverse)

REGULATORY STANDARDS COMPLIANCE













Buy America Standards Eco Friendly

FMVSS 108 s7.1 (Table VII) FMVSS 108 s7.2 (Table VIII) FMVSS 108 s7.3 (Table IX) FMVSS 108 s7.4 (Table X) FMVSS 108 s7.6 (Table XII) FMVSS 108 s8.1 (Table XVI)

 IEC IP67
 SAE J575

 SAE J585
 SAE J586

 SAE J588
 SAE J592

 SAE J593
 SAE J594

Tested to ECE Reg. 10 (Radiated Emissions only)



LED Tail Lights - Model 279 J Series

PHOTOMETRIC SPECIFICATIONS

Beam Pattern(s) Signalization - Stop

Signalization - Tail

Signalization - Turn (Rear)

APPLICATIONS





WARRANTY

Check with your dealer to make sure they can be returned in the event your lights do not function properly.

Hyper-flashing is not warrantable. Read about what causes hyper-flashing and what you can do if you experience it with your LED upgrade on our website at www.jwspeaker.com/hyper-flashing

PRODUCT WARNINGS

For California residents:

▲ **WARNING:** Cancer and reproductive harm - <u>www.P65Warnings.ca.gov</u>.

▲ AVERTISSEMENT: Cancer et effet nocif sur la reproduction - www.P65Warnings.ca.gov.

